






Start by cutting out an 18" square piece of plywood. This will be the bottom of the mold



Find the center of the square. (an easy way is to draw light lines from corner to corner - where they intersect is center).

Use a compass to draw 3 circles on the bottom of the mold. One should be 8" diameter, one 12" diameter, and one 15.5" diameter. The space between the 8" dia and the 12" dia circles is the area that the magnets will rotate over and the coils will need to be centered over these lines. The 15.5 diameter circle shows the outside diameter of the stator and this will help to make sure the middle section of the mold is centered perfectly.

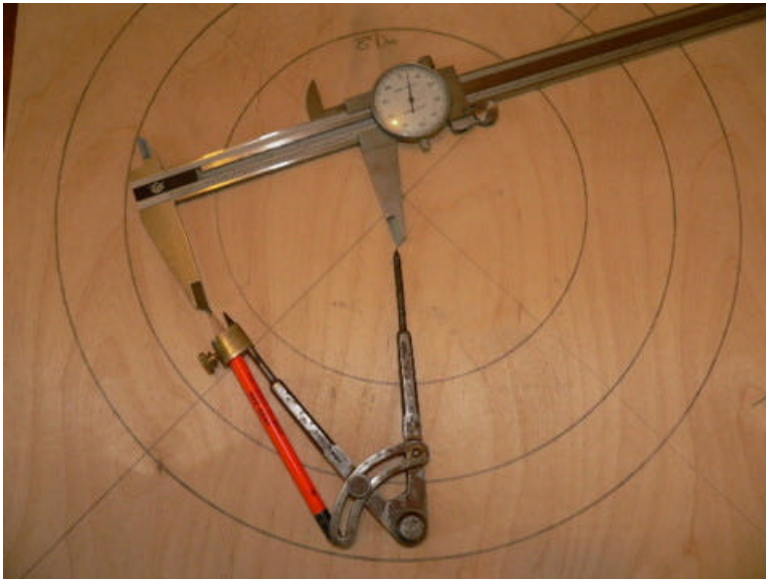

There will be 9 coils and it's nice to draw lines in the mold so that we know the maximum permissible size of each coil. It will also help to be sure that the coils are spaced around the circle properly. In order to divide the circle into 9 equal spaces you need to know the length of one side of the circle. We worked from the 12" diameter circle we drew. An easy way is to use the table of Sides, Angles and Sines. Multiply the sine of the angle (20 deg for 9 sides) times the diameter of the circle you wish to divide (12"). The sine of 20 deg (.342) \* 12 = 4.104" per side.

SIDES, ANGLES & SINES		
NUMBER OF SIDES	ANGLE	SINE
4	45	.707
5	36	.588
6	30	.5
8	22	.383
9	20	.342
10	18	.309
12	15	.259
15	12	.208
16	11	.195
20	9	.156


MULTIPLY SINE BY DIAMETER TO GET THE LENGTH OF A SIDE

The table of sides, angles and sines for the most common numbers we use in these alternators. The angle given is half the actual angle of any segment. To use the table, pick the number of segments (sides) you need to divide the circle into. Multiply the Sine by the diameter of the circle. Set the compass to that length. Pick a starting point and make marks with the compass about half way around the circle.


Then go back to the starting point and work in the opposite direction. This will lessen any error that might come up from imperfect measuring or rounding of numbers, but hopefully you'll come out very close!



Use dial calipers to adjust your compass as shown in the picture. Then pick a starting point on the 12" circle and use the compass to divide the circle into 9 equal parts. This is a nice way to divide any circle - it's very handy for placing magnets and coils accurately in different sized wind turbines.

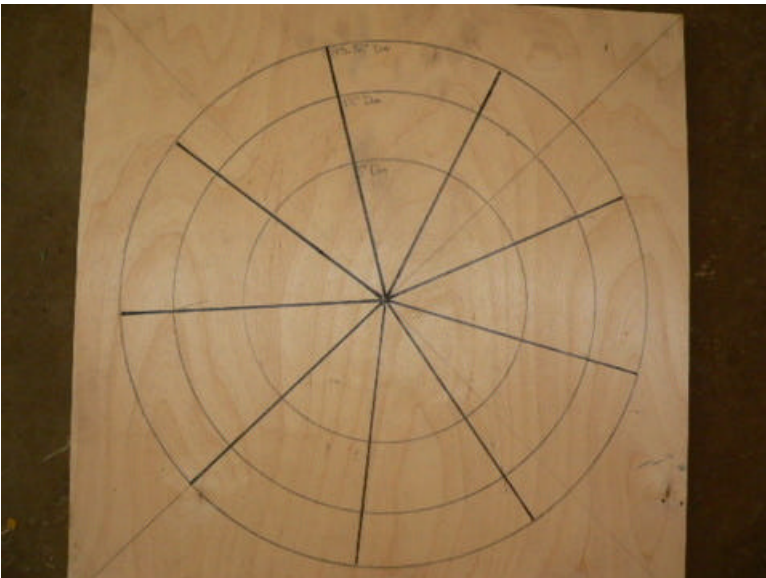

Draw lines from the center to the 15.5" diameter circle to show the space that each coil should occupy.

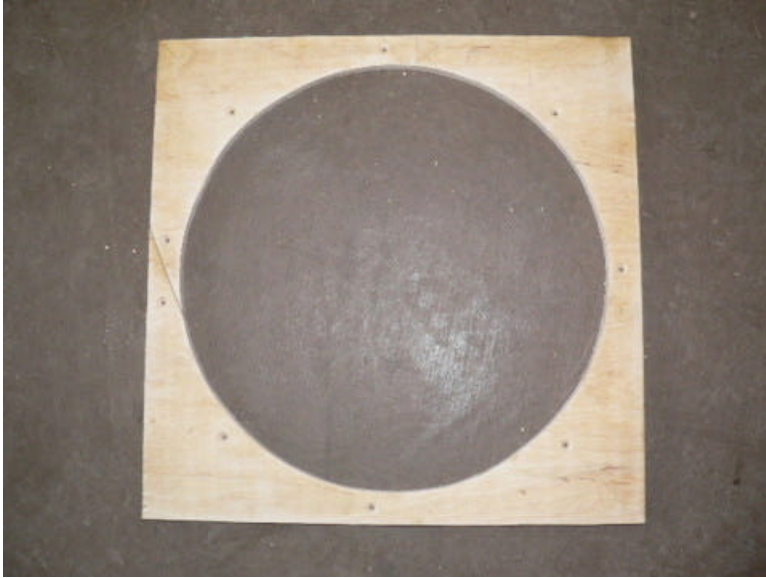


Make another plywood square just like the last one (18" square) and cutout a hole in the center 15.5" in diameter. This is the middle of the mold. Sand the cuts on the inside smooth and try to give it a very slight taper (so that the top is just slightly larger diameter than the bottom). This will make removing the casting easy. Drill holes ( 3/16" diameter for wood screws) around the circle (keep them about 1/2" away from the inside edge). If your's is like the one in the picture, you'll need at at least 9 screws to hold this piece down flat against the bottom of the mold. Run a countersink into the holes deep enough to be sure that all the screws will be flush with (or below) the surface of the mold.



Cut out another disk 5.75" in diameter. This will be the island in the center of the mold. It also needs to be sanded smooth and slightly tapered. Drill 4 holes for wood screws as shown in the picture and run the countersink in just like you did for the middle part of the mold.



Cut out another disk from birch plywood, 16" diameter. This is the lid for the mold. Sand the edges smooth. Drill a 3/4" diameter hole in the center and give it a slight taper with a round file. (sand paper wrapped around a wooden dowel or bolt works nicely too)

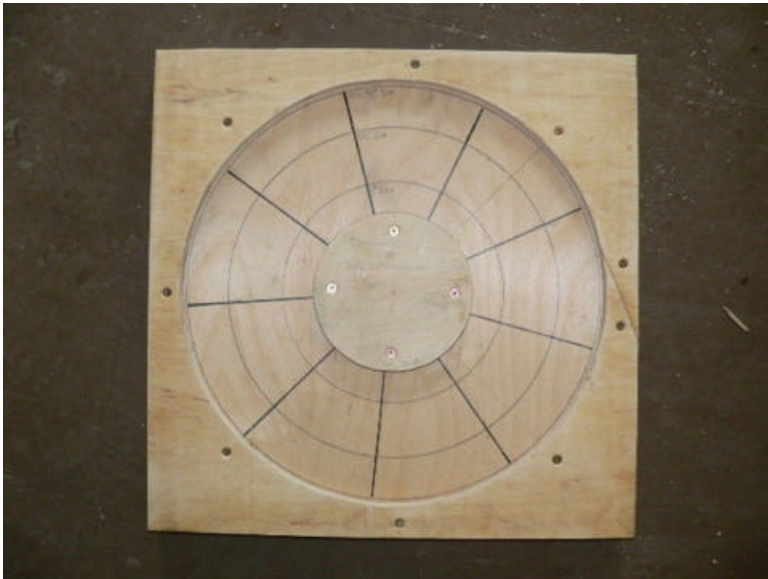

Center the pieces of the mold up and screw them together with 3/4" long wood screws.



If the screws come all the way through the mold, grind the sharp tips off so nobody gets hurt by them.



Drill a 7/16" diameter hole all the way through the center of the mold. We'll be tapping this hole for the threaded rod - since it's wood you could use a smaller drill bit, the tap will cut wood easily.



Tap the hole 1/2" - 13 tpi.



Put a bit of epoxy on the threads of the threaded rod. You may need to double nut the end of the threaded rod but usually you can screw it in by hand. Screw the threaded rod into the hole so that the bottom of the rod comes flush with the bottom of the mold. If any epoxy comes up to the top of the mold wipe it off with a rag.





Wipe the mold down with boiled linseed oil. This will help fill the pores in the wood. When we grease the mold before casting, this assures that the grease will not soak into the mold and the castings will come out more easily. It also protects the mold from water.



Once the linseed oil is dry run a bead of caulk around the edges of the inside of the mold. This will help create a 'tapered' mold, it will also plug any cracks between pieces of plywood to help assure the castings come out easily.



Put the lid on the mold, and hold it there with a 1/2" washer and a nut (the nut will be used to help clamp the lid down when were casting). Put it aside untill you get around to building the stator!

[How we make the stator mold](#) | 7 comments (7 topical, 0 editorial)

**Re: How we make the stator mold (3.00 / 0) (#1)**

by Ding123 on Sat Feb 18th, 2006 at 04:17:21 PM MST

[\(User Info\)](#)

Good going, DanB !! These pointers came at just the right time. I had one built but all three pieces were about 5/8th "...top ,bottom and middle .I didn't even take time to think of the inside of the middle being 1/2 inch , like you have. I will change the middle board to half inch. I don't know what I'll use yet, but anything goes...she's gone to bingo!

**Re: How we make the stator mold (3.00 / 0) (#2)**

by keithturtle ([keithturtle@msn.com](mailto:keithturtle@msn.com)) on Sat Feb 18th, 2006 at 08:40:08 PM MST

[\(User Info\)](#) <http://www.disappearances.info>

I've used a lot of C A glues over the years building model airplanes. By far the best value can be had from Balsa USA. Their thin is super strong and 2 oz. is reasonably priced at \$6.00 usd ea. when you buy 2. Don't get the thick for this application. Find it at <http://www.balsausa.com/>. Get the accellerator but give the glue a minute to set before you kick it- makes a stronger bond. (Don't even THINK of putting the glue on, then the magnet)

Keith

(first post, great forum!)

[ [Parent](#) ]

**Re: How we make the stator mold (3.00 / 0) (#3)**

by Waterfront ([christiangirouardleclerc@hotmail.com](mailto:christiangirouardleclerc@hotmail.com)) on Sun Feb 19th, 2006 at 05:35:18 AM MST

[\(User Info\)](#)

As always, nicely detailed explanations!

When you finish putting all your postings together, I'm sure it'll be one of **the** reference materials to check out before building a windmill!!

Keep up the good work!

Waterfront

**Re: How we make the stator mold (3.00 / 0) (#4)**

by FrankG ([frank@theworkshop.ca](mailto:frank@theworkshop.ca)) on Sun Feb 19th, 2006 at 08:48:02 AM MST  
([User Info](#)) <http://www.theworkshop.ca>

Dan,

This info is great... I hope that all your efforts translate into Sales as OtherPower is more than deserving!

It's just a matter of time to get all this Hard Disk Mag stuff out of my system, but I for one look forward to the day when I'll be placing an order for Mags down the road!

FrankG [www.theworkshop.ca](http://www.theworkshop.ca) [frank@theworkshop.ca](mailto:frank@theworkshop.ca)

**Re: How we make the stator mold (3.00 / 0) (#5)**

by RobD on Mon Feb 20th, 2006 at 07:25:49 AM MST  
([User Info](#)) <http://www.dsgnspec.com>

Thanks Dan.

**Re: How we make the stator mold (3.00 / 0) (#6)**

by Slingshot on Mon Feb 20th, 2006 at 09:10:59 AM MST  
([User Info](#))

Where can I download a copy of DanCAD, so that I can view these sketches and schematics?

**Re: How we make the stator mold (3.00 / 0) (#7)**

by dinges ([pe1vcc@hotmail.com](mailto:pe1vcc@hotmail.com)) on Mon Feb 20th, 2006 at 12:43:43 PM MST  
([User Info](#))

Good stuff! Saved it for future reference.

Peter.

[How we make the stator mold](#) | 7 comments (7 topical, 0 editorial)

Display:   Sort:



You must be a registered user to post here. It's easy and free, and the link is on the upper right side of your page.  
All trademarks and copyrights on this page are owned by their respective companies. Postings are owned by the poster, but may be deleted or moved at the ADMIN's sole discretion. The Rest © 2003 Forcefield.

[You can Email the board ADMIN here.](#) PLEASE include the username you signed up with!